

# UNCLASSIFIED

AD NUMBER
AD454368
NEW LIMITATION CHANGE
TO Approved for public release, distribution unlimited
FROM Distribution authorized to U.S. Gov't. agencies and their contractors; Administrative/Operational Use; 03 DEC 1964. Other requests shall be referred to Naval Civil Engineering Laboratory, Port Hueneme, CA 93041.
AUTHORITY
USNCBC ltr, 24 Oct 1974

THIS PAGE IS UNCLASSIFIED

UNCLASSIFIED

AD 4 5 4 3 6 8

DEFENSE DOCUMENTATION CENTER

FOR

SCIENTIFIC AND TECHNICAL INFORMATION

CAMERON STATION ALEXANDRIA, VIRGINIA



UNCLASSIFIED

NOTICE: When government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U. S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

FOR OFFICIAL USE ONLY

CATALOGED BY **DDC**

AS AD **No. 454368**

**454368**

Technical Report


**R 351**

DIMINISHING PROTECTION  
FOUND IN FLOTATION-TYPE  
BALLAST-TANK PRESERVATIVES

3 December 1964



U. S. NAVAL CIVIL ENGINEERING LABORATORY  
Port Hueneme, California

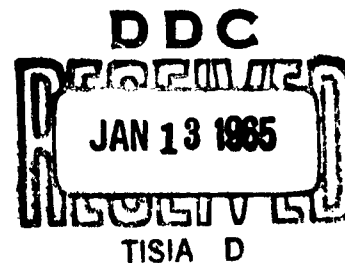

# **DIMINISHING PROTECTION FOUND IN FLOTATION-TYPE BALLAST-TANK PRESERVATIVES**

**Y-R007-08-04-401**

**Type B    Final Report**

**by**

**C. V. Brouillette**

## **ABSTRACT**

Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.

Qualified requesters may obtain copies of this report from DDC.  
The Laboratory invites comment on this report, particularly on the  
results obtained by those who have applied the information.

## INTRODUCTION

The U. S. Naval Civil Engineering Laboratory (NCEL) made a study of used rust-retarding, flotation-type, ballast-tank preservatives. Flotation protective oils used inside ballast tanks to retard corrosion rely upon corrosion inhibitors and other surface-active compounds for their effectiveness. These surface-active compounds have the property of concentrating at the interfaces between oil and steel or rust, oil and water, oil and air, oil and sand particles (including silt), and between oil and any other surface that forms an interface. At the interface, the corrosion-inhibiting molecule becomes oriented in such a way that a portion of the molecule extends into the oil, and the remaining portion adheres to the contacting surface or extends into the water layer.

When the ballast tank is drained, the water pulls some of the corrosion-inhibiting molecules oriented at the oil-water interface into the ocean. When particles of silt and sand are present in the water, they are wetted by the flotation oil and retain these surface-active compounds when they settle to the bottom of the ballast tanks or are carried into the ocean. As fresh rust forms or old rust scale falls away, more corrosion-inhibiting molecules are lost. Thus, flotation oils inside ballast tanks can lose their corrosion-inhibiting character.

Initial studies at this Laboratory<sup>1, 2, 3</sup> had shown that both proprietary and laboratory-prepared floating oils containing surface-active agents and rust-retarding compounds reduced the corrosion losses of steel test specimens to a low amount, at least for the duration of the test period.

In-service field studies had shown that flotation-type corrosion-preventive material in use inside ballast tanks gradually lose their protective ability.<sup>3, 4, 5, 6</sup> Properly prepared and exposed steel test specimens had been shown to be an adequate measure of corrosion in cargo tanks.<sup>7</sup>

During the study of flotation-type protective oils, it was found that a rust-retarding oil, conforming to MIL-C-17936, had lost much of its inhibitive properties after 2 years of use inside the ballast tanks of the USS AFDL-20.<sup>3</sup> This property of an inhibitive oil had been reported previously.<sup>8</sup>

A study of the corrosion occurring on steel test specimens exposed in the ballast tank of a floating drydock in Guam had shown that corrosion of these specimens was reduced from about 0.020 ipy (inches penetration per year) to about 0.001 ipy by a flotation-type oil conforming to MIL-R-21006.<sup>4</sup> This test extended over a period of 3 years. MIL-R-21006\* replaced MIL-C-17936 in 1957.

## TESTS OF USED RUST-RETARDING COMPOUNDS

A request was sent to the command of 42 floating drydocks for 1-gallon samples of rust-retarding flotation oil skimmed from the surface of the residual water in a ballast tank. It was further requested that a tag be attached to the container of used flotation oil giving the following data:

1. Drydock designation and location
2. Name of flotation oil
3. Date oil was first added to drydock
4. Date, name, and approximate percentage of fresh oil added at each replenishing.

Although 34 samples were received from the drydocks, only 21 were samples of rust-retarding, flotation-type, ballast-tank preservatives. These oils were subjected to the simulated ballast-tank testing procedure of MIL-R-21006. The Appendix gives in tabular form the drydocks contacted, those responding, the types of flotation oil, and the condition of the samples.

### Procedure

The procedure called for the simulated ballast tank test to last for 12 weeks. One stipulation of the test is that the corrosion rate of the test panels must not exceed 0.005 ipy.

Both sandblasted and prerusted 4 x 2 x 1/8-inch steel test panels are specified for use in this simulated ballast-tank test. The prerusted panels were first sandblasted and then rusted inside a salt-spray cabinet to a gain in weight of 5 to 7 grams. As specified in this test, 3 sandblasted panels and 3 prerusted panels were suspended near the top of a 5-gallon pail, and similar panels were suspended near the bottom. This simulated ballast tank was filled with synthetic sea water to wet the panels. The

---

\* Military Specification, Rust Retarding Compounds, Flotation Type, Ballast Tank, Protectives, MIL-R-21006 (SHIPS) of 30 August 1957.

water was then lowered to beneath the bottom group of panels. Four-hundred milliliters of preservative flotation oil was added to the surface of the water. The water level was periodically raised and lowered for the first 2 days of the test in order to thoroughly coat the test panels with the protective oil. On the third day, the oil was skimmed off the ballast water, and the ballast water was then completely replaced with fresh synthetic sea water. For the duration of the test, the sea water was periodically raised to submerge the test panels and lowered below the bottom panels.

After 12 weeks, the panels were removed from the simulated ballast tank, cleaned and weighed, and the corrosion losses were calculated.

## Results

Thirteen of the 34 samples received were either practically clear sea water or non-fluid material. Twelve of the drydocks did not submit samples. The 21 usable samples came from 17 drydocks (see Appendix). All of the 21 samples of used oil failed to protect the prerusted test panels within the specified 0.005 ipy (see Table 1). However, 14 of the used flotation oils did protect the sandblasted test panels satisfactorily for the 12-week test period. Sandblasted steel generally receives better protection from oils and greases than does steel coated with rust.<sup>3, 4, 8, 9</sup> Of these 14 samples of used flotation oil, all had been replenished with fresh oil within a year or less.

In three instances, replenishment with fresh oil within the previous 6 months had failed to improve the protective property of the flotation oil sufficiently to meet the requirements of the MIL-R-21006 testing procedure for protecting sandblasted steel. In no instance did the replenishment increase the concentration of corrosion inhibitors sufficiently to protect the prerusted steel test specimens. However, in five instances where the oil was replenished in large amounts or shortly before the sample was obtained, the corrosion rate of the prerusted steel panels was reduced to 0.008 ipy. It was noted that in one case (AFDL-16), a 6-month-old charge of flotation protective oil had lost its protective property to the extent that neither prerusted nor sandblasted steel test panels were protected to 0.008 ipy during the 12-week test.

A sample of fresh, unused flotation oil, Eureka Fluid Film 220/221, was used as a control. This oil protected the prerusted and the sandblasted steel test specimens within the requirements of the MIL-SPEC. The test method imposed a severe corrosion rate of 0.044 ipy for unprotected prerusted steel test specimens and of 0.028 ipy for the unprotected sandblasted steel specimens. These corrosion rates are more than double the average corrosion rates found in overhead areas of a

drydock at Guam.<sup>4</sup> The fresh Eureka Fluid Film 220/221 reduced these corrosion rates by about 90 percent for prerusted steel and by about 96 percent for sandblasted steel during the 12-week test period. The corrosion rate of 0.008 ipy for flotation oils in use inside a drydock for 1 year or less (Table I) showed the oils to have a residual capacity for about an 80 percent reduction in the corrosion rate of the prerusted steel. This capability of a used oil, coupled with the corrosion-inhibiting property initially imparted to the steel surfaces inside the ballast tanks at the time of application of the oil as new material, is considered indicative of satisfactory protection to the oil-coated areas of these drydocks at the time the sample was taken.

Those oils which were not replenished by nearly 100 percent each year did not give a high percentage of protection.

## DISCUSSION

The results of this survey and study show that within a period of 1 year, the flotation oils inside a ballast tank of a floating drydock usually retained sufficient amounts of the surface-active components to protect sandblasted steel specimens satisfactorily throughout the 12-week period of the test. But the ability of this oil to penetrate freshly rusted surfaces and coat the underlying steel surface was not sufficient to give protection to prerusted steel specimens within the requirements of the MIL-SPEC. However, these oils did give the prerusted specimens a protection of about 80 percent. As stated before, this residual capacity is considered sufficient to indicate that satisfactory protection was in effect inside these drydocks at the time of sampling.

Observations made during field inspection of ballast tanks have shown that although the residual ballast water in the tanks was covered with flotation oil, large areas of the steel overhead were not oil-coated and were badly rusted.<sup>4</sup> Unretarded corrosion rate in these areas was found to be 0.020 ipy or more.<sup>4</sup>

## CONCLUSIONS

From this study, the following conclusions were made:

1. Rust-retarding, flotation-type, ballast-tank preservatives will not meet the MIL-SPEC requirements after a few months' service inside the ballast tank of a floating drydock.

2. With suitable replenishment (approximately 100 percent per year), rust-retarding, flotation-type oils will reduce corrosion by better than 80 percent to all ballast-tank surfaces coated.
3. Because of improper use or maintenance of these oils, only 15 percent of the drydocks submitting samples were receiving satisfactory protection of their ballast tanks.

## REFERENCES

1. U. S. Naval Civil Engineering Research and Evaluation Laboratory. Technical Note N-172: Tests on chemical compounds used as corrosion inhibitors when applied as floating coatings, by C. V. Brouillette, G. E. Sanford, and J. H. Strimple. Port Hueneme, Calif., 19 Nov. 1953.
2. \_\_\_\_\_. Technical Note N-285: Test on flotation-type rust preventives, by C. V. Brouillette. Port Hueneme, Calif., 15 Nov. 1956.
3. U. S. Naval Civil Engineering Laboratory. Technical Note N-576: Flotation type corrosion inhibitors, by Carl V. Brouillette. Port Hueneme, Calif., 16 June 1964.
4. \_\_\_\_\_. Technical Note N-564: Protective coatings in drydocks at Guam, by C. V. Brouillette. Port Hueneme, Calif., 28 Feb. 1964.
5. E. R. Streed. "Study of the compatability of floating-type inhibitors and cathodic protection." Corrosion, vol. 14, no. 3, Mar. 1958, pp. 50-54.
6. Pacific Naval Laboratory. Technical Memorandum 59-2: Interim evaluation of flotation type rust retarder, by J. A. H. Carson. Esquimalt, B. C., Canada, Feb. 1959.
7. J. D. Sudbury, D. A. Shock, and F. W. Mann. "A promising spray-applied inhibitor of internal corrosion of oil tank ships." Corrosion, vol. 10, no. 8, Aug. 1954, pp. 253-258.
8. U. S. Naval Research Laboratory. NRL Report No. P-2474: Anti-rust additives for lubricating, power transmission and protective oils, by Hayward R. Baker and William A. Zisman. Anacostia Station, Washington, D. C., Feb. 1945.
9. U. S. Naval Engineering Experiment Station. Research Report 610438A: EES participation in shipboard trials of ballast tank protective systems. Annapolis, Md., 20 Apr. 1960.

Table 1. Corrosion Losses

Drydock	Compound	Years in Use	Replenishment		Corrosion Loss (ipy) <sup>1/</sup>	
			%	Time Since	Prerusted	Sandblasted
AFDL-1-(a)	NO-OX-ID 519 "A" Special	1.5	1.5	6 mo	0.014	0.002
AFDL-1-(b)	Corrosion Battler A/B	1.0	30	1 mo	0.008	0.001
AFDL-1-(c)	Yosemite 610/610 A	1.5	20	1 mo	0.016	0.011
AFDL-1-(d)	Corrosion Battler A/B	1.5	40	1 mo	0.008	0.001
AFDL-5	Yosemite 610/610 A	2.0	50	1 yr	0.012	0.002
AFDL-6	Yosemite 610/610 A	1.0	10	4 mo	0.019	0.002
AFDL-9	Yosemite 610/610 A	4.0	33	6 mo	0.013	0.001
AFDL-16	Floatcoat	0.5	0	6 mo	0.014	0.006
AFDL-27	Floatcoat	0.25	0	3 mo	0.012	0.004
ARD-12	Corrosion Battler A/B	2.0	0	—	0.010	0.004
ARD-14	Yosemite 610/610 A	2.5	33	1 yr	0.012	0.001
ARD-23	Corrosion Battler HFC	0.25	0	3 mo	0.008	0.001
ARD-29	Floatcoat	1.5	0	—	0.015	0.011
ARD-30-(a)	Yosemite 610/610 A	3.0	75	6 mo	0.028	0.003
ARD-30-(b)	Tricon	0.33	0	4 mo	0.008	0.004
AFDM-4	Floatcoat	4.0	50	6 mo	0.018	0.014
AFDM-5	Yosemite 610	4.0	100	1 yr	0.008	0.001
AFDM-6	Floatcoat	4.0	100	1 mo	0.009	0.008
YFD-70	Yosemite 610/610 A/615	1.0	20	6 mo	0.009	0.001
YFD-71	Yosemite 610/610 A	4.0	40	2 yr	0.020	0.029
Controls						
Eureka Fluid Film 220/221 fresh un-used oil					0.004	0.001
Uncoated steel panels					0.044	0.028

<sup>1/</sup> Inches penetration per year

Appendix

SAMPLES OF BALLAST-TANK PRESERVATIVES  
RECEIVED FROM DRYDOCKS

<u>Drydock</u>	<u>Flotation Oil</u>	<u>Remarks</u>
AFDL-1-(a)	NO-OX-ID 519 "A" Special	viscous, gas pressure
AFDL-1-(b)	Corrosion Battler A/B	fluid, H <sub>2</sub> S odor
AFDL-1-(c)	Yosemite 610/610 A	fluid
AFDL-1-(d)	Yosemite 610/610 A and Corrosion Battler A/B	viscous, 3/4 water layer
AFDL-5	Yosemite 610/610 A	viscous, gas pressure, rust scale, 1/2 water layer
AFDL-6	Yosemite 610/610 A	fluid
AFDL-8	No sample	—
AFDL-9	Yosemite 610/610 A	very viscous
AFDL-15	No sample	—
AFDL-16	Floatcoat	fluid
AFDL-18	Corrosion Battler A/B	not fluid, H <sub>2</sub> S odor
AFDL-26	No sample	—
AFDL-27	Floatcoat	fluid
AFDL-28	No sample	in overhaul
AFDL-29	No sample	—
AFDL-30	No sample	—
AFDL-31	Corrosion Battler A/B	not fluid, lower half grease-rust mass, gas pressure
ARD-7	Yosemite 610/610 A	1 gallon of clear sea water
ARD-11	Yosemite 610/610 A	1 gallon of clear sea water
ARD-12	Corrosion Battler A/B	fluid, H <sub>2</sub> S odor, 1/3 water layer
ARD-14	Yosemite 610/610 A	very viscous

<u>Drydock</u>	<u>Flotation Oil</u>	<u>Remarks</u>
ARD-15	Corrosion Battler A/B	fluid, H <sub>2</sub> S odor
ARD-16	Corrosion Battler A/B	1 gallon of sea water plus a trace of oil
ARD-17	No sample	in overhaul
ARD-18	Corrosion Battler G	not fluid
ARD-23	Corrosion Battler HFC	fluid, H <sub>2</sub> S odor, 1/4 water layer
ARD-26	No sample	in overhaul
ARD-29	Floatcoat	fluid, 3/4 water layer
ARD-30	Yosemite 610/610 A	fluid, 3/4 water layer
ARD-32	Yosemite 610/610 A	1 gallon of clear sea water
AFDM-1	Yosemite 610/610 A	not fluid
AFDM-2	None	a bitumastic coating in tanks
AFDM-3	Yosemite 610/610 A	in overhaul
AFDM-4-(a)	Floatcoat	fluid, 3/4 water layer
AFDM-4-(b)	Yosemite 610/610 A	not fluid, gas pressure, garbage odor
AFDM-5	Yosemite 610	viscous, gas pressure, H <sub>2</sub> S odor
AFDM-6	Floatcoat	fluid
AFDM-7	Unknown	not fluid, gas pressure
AFDM-9	Floatcoat	1 gallon of clear sea water
AFDM-10	No sample	—
YFD-7	Yosemite 610/610 A	not fluid
YFD-68	Yosemite 610/610 A	not fluid
YFD-69	No sample	on lease, scheduled to use Yosemite
YFD-70	Yosemite 610/610 A, replenished by 615	viscous
YFD-71	Yosemite 610/610 A	fluid
YFD-82	No sample	—

# DISTRIBUTION LIST

SNDL Code	No. of Activities	Total Copies	
	1	10	Chief, Bureau of Yards and Docks (Code 42)
23A	1	1	Naval Forces Commanders (Taiwan only)
39B	2	2	Construction Battalions
39D	5	5	Mobile Construction Battalions
39E	3	3	Amphibious Construction Battalions
39F	1	2	Construction Battalion Base Units
A2A	1	1	Chief of Naval Research - Only
A3	2	2	Chief of Naval Operation (OP-07, OP-04)
A5	5	5	Bureaus
B3	2	2	Colleges
E4	1	2	Laboratory ONR (Washington, D. C. only)
E5	1	1	Research Office ONR (Pasadena only)
E16	1	1	Training Device Center
F9	7	7	Station - CNO (Boston; Key West; San Juan; Long Beach; San Diego; Treasure Island; and Rodman, C. Z. only)
F17	6	6	Communication Station (San Juan; San Francisco; Pearl Harbor; Adak, Alaska; and Guam only)
F41	1	1	Security Station
F42	1	1	Radio Station (Oso and Cheltenham only)
F48	1	1	Security Group Activities (Winter Harbor only)
F61	2	2	Naval Support Activities (London and Naples only)
F77	1	1	Submarine Base (Groton, Conn. only)
F81	2	2	Amphibious Bases
H3	7	7	Hospital (Chelsea; St. Albans, Portsmouth, Va.; Beaufort; Great Lakes; San Diego; and Camp Pendleton only)
H6	1	1	Medical Center
J1	2	2	Administration Command and Unit - BuPers (Great Lakes and San Diego only)
J3	1	1	U. S. Fleet Anti-Air Warfare Training Center (Virginia Beach only)
J19	1	1	Receiving Station (Brooklyn only)
J34	1	1	Station - BuPers (Washington, D. C. only)

# DISTRIBUTION LIST (Cont'd)

SNDL Code	No. of Activities	Total Copies	
J46	1	1	Personnel Center
J48	1	1	Construction Training Unit
J60	1	1	School Academy
J65	1	1	School CEC Officers
J84	1	1	School Postgraduate
J90	1	1	School Supply Corps
J95	1	1	School War College
J99	1	1	Communication Training Center
L1	11	11	Shipyards
L7	4	4	Laboratory - BuShips (New London; Panama City; Carderock; and Annapolis only)
L26	5	5	Naval Facilities - BuShips (Antigua; Turks Island; Barbados; San Salvador; and Eleuthera only)
L42	2	2	Fleet Activities - BuShips
M27	4	4	Supply Center
M28	6	6	Supply Depot (except Guantanamo Bay; Subic Bay; and Yokosuka)
M61	2	2	Aviation Supply Office
N1	6	18	BuDocks Director, Overseas Division
N2	9	27	Public Works Offices
N5	3	9	Construction Battalion Center
N6	5	5	Construction Officer-in-Charge
N7	1	1	Construction Resident-Officer-in-Charge
N9	6	12	Public Works Center
N14	1	1	Housing Activity
R9	2	2	Recruit Depots
R10	2	2	Supply Installations (Albany and Barstow only)
R20	1	1	Marine Corps Schools (Quantico)
R64	3	3	Marine Corps Base
R66	1	1	Marine Corps Camp Detachment (Tengan only)
W1A1	6	6	Air Station
W1A2	35	35	Air Station
W1B	8	8	Air Station Auxiliary

# DISTRIBUTION LIST (Cont'd)

SNDL Code	No. of Activities	Total Copies	
WIC	3	3	Air Facility (Phoenix; Naha; and Naples only)
WIE	6	6	Marine Corps Air Station (except Quantico)
WIH	9	9	Station - BuWeps (except Rota)
	1	1	Deputy Chief of Staff, Research and Development, Headquarters, U. S. Marine Corps, Washington, D. C.
	1	1	President, Marine Corps Equipment Board, Marine Corps School, Quantico, Va.
	1	1	Chief of Staff, U. S. Army, Chief of Research and Development, Department of the Army, Washington, D. C.
	1	1	Office of the Chief of Engineers, Assistant Chief of Engineering for Civil Works, Department of the Army, Washington, D. C.
	1	1	Chief of Engineers, Department of the Army, Washington, D. C., Attn: Engineering Research and Development Division
	1	1	Chief of Engineers, Department of the Army, Washington, D. C., Attn: ENG CW-OE
	1	3	Headquarters, U. S. Air Force, Directorate of Civil Engineering, Washington, D. C., Attn: AFOCE-ES
	1	1	Commanding Officer, U. S. Naval Construction Battalion Center, Port Hueneme, Calif., Attn: Materiel Dept., Code 140
	1	1	Deputy Chief of Staff, Development, Director of Research and Development, Department of the Air Force, Washington, D. C.
	1	1	Director, National Bureau of Standards, Department of Commerce, Connecticut Avenue, Washington, D. C.
	1	2	Office of the Director, U. S. Coast and Geodetic Survey, Washington, D. C.
	1	20	Defense Documentation Center, Building 5, Cameron Station, Alexandria, Va.
	1	2	Director of Defense Research and Engineering, Department of Defense, Washington, D. C.
	1	2	Director, Bureau of Reclamation, Washington, D. C.
	1	1	Facilities Officer, Code 108, Office of Naval Research, Washington, D. C.
	1	1	Federal Aviation Agency, Office of Management Services, Administrative Services Division, Washington, D. C., Attn: Library Branch

# DISTRIBUTION LIST (Cont'd)

No. of Activities	Total Copies	
1	2	Commander Naval Beach Group Two, U. S. Naval Amphibious Base, Little Creek, Norfolk, Va.
1	1	Commander, Pacific Missile Range, Technical Documentation Section, P. O. Box 10, Point Mugu, Calif., Attn: Code 4332
1	2	U. S. Army Engineer Research and Development Laboratories, Attn: STINFO Branch, Fort Belvoir, Va.
1	1	Systems Engineering Group, Deputy for Systems Engineering, Directorate of Technical Publications and Specifications, Wright-Patterson AFB, Ohio
1	10	Chief, Bureau of Ships, Attn: Chief of Research and Development Division, Navy Department, Washington, D. C.
1	1	Officer in Charge, U. S. Naval Biological Laboratory, Naval Supply Center, Oakland, Calif.
1	1	Commander, Amphibious Force, U. S. Atlantic Fleet, U. S. Naval Base, Norfolk, Va.
1	1	Commander, Norfolk Naval Shipyard, Attn: Chemical Laboratory, Portsmouth, Va.
1	1	Commanding Officer, Fleet Training Center, Navy No. 128, FPO, San Francisco, Calif.
1	1	Commander, U. S. Naval Shipyard, Attn: Materials and Chemical Laboratory, Boston, Mass.
1	1	U. S. Naval Applied Science Laboratory, Technical Library, Building 291, Code 9832, Naval Base, Brooklyn, N. Y.
1	1	Office of Naval Research, Branch Office, Navy No. 100, Box 39, FPO, New York
1	1	U. S. Naval Research Laboratory, Chemistry Division, Washington, D. C.
1	1	Commandant, 1st Naval District, Attn: CEC Naval Reserve Program Officer, 495 Summer Street, Boston, Mass.
1	1	Commandant, 3rd Naval District, Attn: CEC Naval Reserve Program Officer, 90 Church Street, New York, N. Y.
1	1	Commandant, 4th Naval District, Attn: CEC Naval Reserve Program Officer, Naval Base, Philadelphia, Penn.
1	1	Commandant, 5th Naval District, Attn: CEC Naval Reserve Program Officer, Norfolk, Va.
1	1	Commandant, 6th Naval District, Attn: CEC Naval Reserve Program Officer, U. S. Naval Base, Charleston, S. Car.
1	1	Commandant, 8th Naval District, Attn: CEC Naval Reserve Program Officer, U. S. Naval Station, New Orleans, La.

# DISTRIBUTION LIST (Cont'd)

No. of Activities	Total Copies	
1	1	Commandant, 9th Naval District, Attn: CEC Naval Reserve Program Officer, Building 1, Great Lakes, Ill.
1	1	Commandant, 11th Naval District, Attn: CEC Naval Reserve Program Officer, 937 N. Harbor Drive, San Diego, Calif.
1	1	Commandant, 12th Naval District, Attn: CEC Naval Reserve Program Officer, Federal Office Building, San Francisco, Calif.
1	1	Commandant, 13th Naval District, Attn: CEC Naval Reserve Program Officer, Seattle, Wash.
1	1	Paint Laboratory, U. S. Engineers Office, Clock Tower Building, Rock Island, Ill.
1	1	Directorate of Medical Research, Chemical Warfare Laboratory, Army Chemical Center, Md.
1	1	Mr. J. R. Moses, Director (C-46), Materials Division, District Public Works Office, 14ND, Navy No. 128, FPO, San Francisco, Calif.
1	1	Mr. W. E. Edwards (Code 64 WEE), Pacific Division, Bureau of Yards and Docks, Navy No. 128, FPO, San Francisco, Calif.
1	1	Director, National Bureau of Standards, Department of Commerce, Connecticut Avenue, Washington, D. C., Attn: Mr. Melvin Romanoff
1	1	Mr. Marvin J. Bistodeau, Department Head, PWC/OICC Code E1, Navy No. 926, FPO, San Francisco, Calif.
1	1	Mr. Fred L. de Boer, Harbor Facilities, Maintenance Division, Pacific Division, Bureau of Yards and Docks, Navy No. 128, FPO, San Francisco, Calif.
1	1	Officer in Charge, USAFDM-8, Navy No. 926, FPO, San Francisco, Calif.
1	1	Commanding Officer, USS ARD-29, Navy No. 926, FPO, San Francisco, Calif.

Unclassified

Security Classification

DOCUMENT CONTROL DATA - R&D		
<i>(Security classification of title, body of abstract and indexing annotation must be entered when the overall report is classified)</i>		
1. ORIGINATING ACTIVITY <i>(Corporate author)</i>  U. S. Naval Civil Engineering Laboratory Port Hueneme, California 93041		2a. REPORT SECURITY CLASSIFICATION  Unclassified
		2b. GROUP
3. REPORT TITLE  Diminishing Protection Found in Flotation-Type Ballast-Tank Preservatives		
4. DESCRIPTIVE NOTES <i>(Type of report and inclusive dates)</i> Final, January 1960-May 1962		
5. AUTHOR(S) <i>(Last name, first name, initial)</i>  Brouillette, C. V.		
6. REPORT DATE 3 December 1964	7a. TOTAL NO. OF PAGES 13	7b. NO. OF REFS 9
8a. CONTRACT OR GRANT NO.  b. PROJECT NO. Y-R007-08-04-401  c.  d.	9a. ORIGINATOR'S REPORT NUMBER(S)  TR-351	
9b. OTHER REPORT NO(S) <i>(Any other numbers that may be assigned this report)</i>		
10. AVAILABILITY/LIMITATION NOTICES  Qualified requesters may obtain copies of this report from DDC.		
11. SUPPLEMENTARY NOTES  For Official Use Only	12. SPONSORING MILITARY ACTIVITY  BuDocks	
13. ABSTRACT  Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that, because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.		

Unclassified

Security Classification

14. KEY WORDS	LINK A		LINK B		LINK C	
	ROLE	WT	ROLE	WT	ROLE	WT
Corrosion Prevention	8					
Rust Prevention	8					
Coatings	10		8			
Inhibitors	10		8			
Preservatives	10		8			
Drydocks	4		4			
Ballast Tanks	4		4			

#### INSTRUCTIONS

1. **ORIGINATING ACTIVITY:** Enter the name and address of the contractor, subcontractor, grantee, Department of Defense activity or other organization (*corporate author*) issuing the report.

2a. **REPORT SECURITY CLASSIFICATION:** Enter the overall security classification of the report. Indicate whether "Restricted Data" is included. Marking is to be in accordance with appropriate security regulations.

2b. **GROUP:** Automatic downgrading is specified in DoD Directive 5200.10 and Armed Forces Industrial Manual. Enter the group number. Also, when applicable, show that optional markings have been used for Group 3 and Group 4 as authorized.

3. **REPORT TITLE:** Enter the complete report title in all capital letters. Titles in all cases should be unclassified. If a meaningful title cannot be selected without classification, show title classification in all capitals in parenthesis immediately following the title.

4. **DESCRIPTIVE NOTES:** If appropriate, enter the type of report, e.g., interim, progress, summary, annual, or final. Give the inclusive dates when a specific reporting period is covered.

5. **AUTHOR(S):** Enter the name(s) of author(s) as shown on or in the report. Enter last name, first name, middle initial. If military, show rank and branch of service. The name of the principal author is an absolute minimum requirement.

6. **REPORT DATE:** Enter the date of the report as day, month, year, or month, year. If more than one date appears on the report, use date of publication.

7a. **TOTAL NUMBER OF PAGES:** The total page count should follow normal pagination procedures, i.e., enter the number of pages containing information.

7b. **NUMBER OF REFERENCES:** Enter the total number of references cited in the report.

8a. **CONTRACT OR GRANT NUMBER:** If appropriate, enter the applicable number of the contract or grant under which the report was written.

8b, &c, & 8d. **PROJECT NUMBER:** Enter the appropriate military department identification, such as project number, subproject number, system numbers, task number, etc.

9a. **ORIGINATOR'S REPORT NUMBER(S):** Enter the official report number by which the document will be identified and controlled by the originating activity. This number must be unique to this report.

9b. **OTHER REPORT NUMBER(S):** If the report has been assigned any other report numbers (*either by the originator or by the sponsor*), also enter this number(s).

10. **AVAILABILITY/LIMITATION NOTICES:** Enter any limitations on further dissemination of the report, other than those

imposed by security classification, using standard statements such as:

- (1) "Qualified requesters may obtain copies of this report from DDC."
- (2) "Foreign announcement and dissemination of this report by DDC is not authorized."
- (3) "U. S. Government agencies may obtain copies of this report directly from DDC. Other qualified DDC users shall request through \_\_\_\_\_."
- (4) "U. S. military agencies may obtain copies of this report directly from DDC. Other qualified users shall request through \_\_\_\_\_."
- (5) "All distribution of this report is controlled. Qualified DDC users shall request through \_\_\_\_\_."

If the report has been furnished to the Office of Technical Services, Department of Commerce, for sale to the public, indicate this fact and enter the price, if known.

11. **SUPPLEMENTARY NOTES:** Use for additional explanatory notes.

12. **SPONSORING MILITARY ACTIVITY:** Enter the name of the departmental project office or laboratory sponsoring (*paying for*) the research and development. Include address.

13. **ABSTRACT:** Enter an abstract giving a brief and factual summary of the document indicative of the report, even though it may also appear elsewhere in the body of the technical report. If additional space is required, a continuation sheet shall be attached.

It is highly desirable that the abstract of classified reports be unclassified. Each paragraph of the abstract shall end with an indication of the military security classification of the information in the paragraph, represented as (TS), (S), (C), or (U).

There is no limitation on the length of the abstract. However, the suggested length is from 150 to 225 words.

14. **KEY WORDS:** Key words are technically meaningful terms or short phrases that characterize a report and may be used as index entries for cataloging the report. Key words must be selected so that no security classification is required. Identifiers, such as equipment model designation, trade name, military project code name, geographic location, may be used as key words but will be followed by an indication of technical context. The assignment of links, roles, and weights is optional.

U. S. Naval Civil Engineering Laboratory  
DIMINISHING PROTECTION FOUND IN FLOTATION-TYPE  
BALLAST-TANK PRESERVATIVES, by C. V. Brouillette  
TR-351 13 p. illus 3 Dec 64 Official Use Only

1. Rust retardation 2. Ballast tank preservatives 1. Y-R007-08-04-401

Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that, because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.

U. S. Naval Civil Engineering Laboratory  
DIMINISHING PROTECTION FOUND IN FLOTATION-TYPE  
BALLAST-TANK PRESERVATIVES, by C. V. Brouillette  
TR-351 13 p. illus 3 Dec 64 Official Use Only

1. Rust retardation 2. Ballast tank preservatives 1. Y-R007-08-04-401

Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that, because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.

U. S. Naval Civil Engineering Laboratory  
DIMINISHING PROTECTION FOUND IN FLOTATION-TYPE  
BALLAST-TANK PRESERVATIVES, by C. V. Brouillette  
TR-351 13 p. illus 3 Dec 64 Official Use Only

1. Rust retardation 2. Ballast tank preservatives 1. Y-R007-08-04-401

Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that, because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.

U. S. Naval Civil Engineering Laboratory  
DIMINISHING PROTECTION FOUND IN FLOTATION-TYPE  
BALLAST-TANK PRESERVATIVES, by C. V. Brouillette  
TR-351 13 p. illus 3 Dec 64 Official Use Only

1. Rust retardation 2. Ballast tank preservatives 1. Y-R007-08-04-401

Samples of used rust-retarding, flotation-type, ballast-tank preservatives were taken from 30 floating drydocks to analyze their corrosion-resisting properties. After a few months' service inside the ballast tank of a floating drydock, these oils were found to fail the MIL-SPEC requirements for rust retardation. It was found that, because of improper use of these oils, only about 20 percent of the drydocks were receiving as much as 80 percent reduction in corrosion.